

COOK MEDICAL EUROPE LTD.
O'HALLORAN ROAD
NATIONAL TECHNOLOGY PARK
LIMERICK, V94 N8X2, IRELAND
TEL: +353 61 334440 FAX: +353 61 334441
WWW.COOKMEDICAL.EU

FSN & FSCA Ref: 2020FA0002

Date: 17-Jan-2020

<u>Urgent Field Safety Notice</u> Product Removal- Hemospray Endoscopic Hemostat

For Attention of: Chief Executive / Risk Management / Purchasing/ Recall Coordinator

Contact details of local representative (name, e-mail, telephone, address etc.)

Cook Medical Europe Ltd.

O'Halloran Road

National Technology Park

Limerick, Ireland

E-mail: European.FieldAction@CookMedical.com

Phone: Please refer to the attached Country Contacts List

For any further information or support concerning the information within this FSN, please contact your local Cook Medical Sales Representative or Cook Medical Europe Ltd.



COOK MEDICAL EUROPE LTD.
O'HALLORAN ROAD
NATIONAL TECHNOLOGY PARK
LIMERICK, V94 N8X2, IRELAND
TEL: +353 61 334440 FAX: +353 61 334441
WWW.COOKMEDICAL.EU

FSN & FSCA Ref: 2020FA0002

Urgent Field Safety Notice (FSN) Hemospray Endoscopic Hemostat Risk addressed by FSN

	Information on Affected Devices					
1.	1. Device Type(s)					
Hemospray Endoscopic Hemostat is an upper-gastrointestinal haemostasis dev supplied sterile.						
1.						
	Hemospray Endoscopic Hemostat					
1.	Primary clinical purpose of device(s)					
	This device is used for haemostasis of nonvariceal upper gastrointestinal bleeding.					
1.	Device Model/Catalogue/part number(s)					
	HEMO-7-EU, HEMO-10-EU					
1.	Affected serial or lot number range					
	All lot numbers manufactured 16 January 2017 to 15 January 2020.					

	Reason for Field Safety Corrective Action (FSCA)						
2.	Description of the product problem						
Cook Medical has received complaints regarding Hemospray Endoscopic Hem							
	devices for the handle and/or activation knob cracking or breaking while the device						
	activated, prior to and during use. This has led to the carbon dioxide cartridge exiting the						
	handle. Most of these complaints reported that the carbon dioxide cartridge exited the						
	handle with minimal force. However, there have been complaints that the carbon dioxid						
	cartridge exited the handle with force. There has been one (1) complaint reported when						
	the user sustained a laceration to the hand which required basic first aid.						
2.	2. Hazard giving rise to the FSCA						
	Potential adverse effects to the user that may occur if an affected product is used included in the control of						
	superficial laceration, laceration, or permanent impairment of a body structure. Please						
	note that there have been no reports of a serious deterioration to the state of health						
2.	the user due to the carbon dioxide cartridge exiting the handle.						
۷.	7 1 5						
	The probability of this incident occurring is 0.022%.						
2.	4. Predicted risk to patient/users						
	The individual risk of harm to the user is negligible.						
2. 5. Background on Issue							
	Cook Medical has received complaints regarding Hemospray Endoscopic Hemostat						
devices for the handle and/or activation knob cracking or breaking while the dev							
activated; some of which have led to the carbon dioxide cartridge exiting the de							
	There is no root cause for this issue at this time.						



COOK MEDICAL EUROPE LTD.
O'HALLORAN ROAD
NATIONAL TECHNOLOGY PARK
LIMERICK, V94 N8X2, IRELAND
TEL: +353 61 334440 FAX: +353 61 334441
WWW.COOKMEDICAL.EU

FSN & FSCA Ref: 2020FA0002

	Type of Action to mitigate the risk							
3.	1.							
		□ Identify Device □ C □ C	uarantine	Device	□ Return Device □			
		⊠ Other						
		Please complete the enclosed Reply Form. Where product is indicated as being returned, our Customer Services department will contact you to organize the return and issue you with the relevant Returns Authorization number. Please include contact details on the Reply Form.						
		Returned Product should be addressed to: Cook Medical EUDC Robert-Koch-Straße, 2 52499 Baesweiler Germany						
		Credit will be provided fo	r the returi	ned affected pr	oducts where applicable.			
3.	2.	By when should the action be completed?	Within fi	ive (5) business	days of receipt.			
3.	3.	Is customer Reply Require	ed? *	Yes, within	n five (5) business days of receipt.			
3.	4.	Action Being Taken by the Manufacturer						
		⊠ Product Removal						
		Hemospray devices are being removed from the market and should be returned to Cook per the attached directions on the Field Action Reply Form.						
3	5.	By when should the action be completed?	With	Within five (5) business days of receipt.				
3.	6.	Is the FSN required to be communicated to the patie user?	ent /lay	No				



COOK MEDICAL EUROPE LTD.
O'HALLORAN ROAD
NATIONAL TECHNOLOGY PARK
LIMERICK, V94 N8X2, IRELAND
TEL: +353 61 334441 FAX: +353 61 334441
WWW.COOKMEDICAL.EU

FSN & FSCA Ref: 2020FA0002

General Information							
4.	1. FSN Type	New					
4.	Further advice or information already expected in follow-up FSN?	No					
4.	Manufacturer information (For contact details of local representative refer to page 1 of this FSN)						
	a. Company Name	Cook Endoscopy/Wilson-Cook Medical, Inc.					
	b. Address	4900 Bethania Station Road, Winston-Salem, NC USA					
4.	4. The Competent (Regulatory) Authority of your country has been informed about this communication to customers.						
4.	5. Name/Signature	Blair Younts Team Lead, Regulatory Reporting & Field Actions					

Transmission of this Field Safety Notice

This notice needs to be passed on all those who need to be aware within your organisation or to any organisation where the potentially affected devices have been transferred.

Please transfer this notice to other organisations on which this action has an impact.

Please maintain awareness on this notice and resulting action for an appropriate period to ensure effectiveness of the corrective action.

Please report all device-related incidents to the manufacturer, distributor or local representative, and the national Competent Authority if appropriate, as this provides important feedback.